

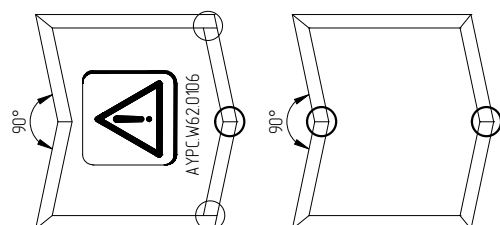
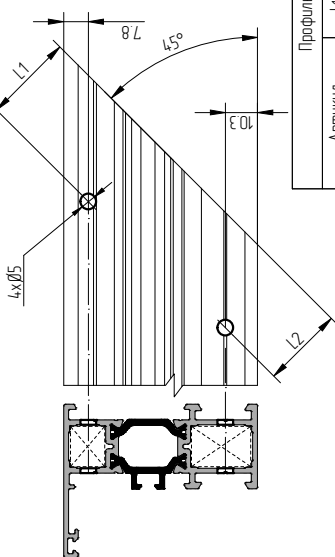
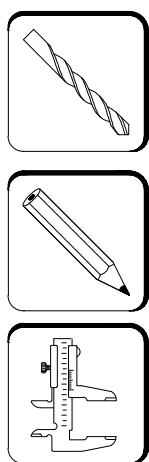
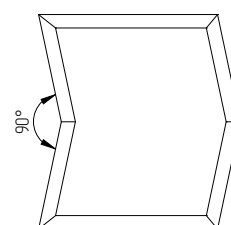





Обработка профиля для углового соединения методом штифтования

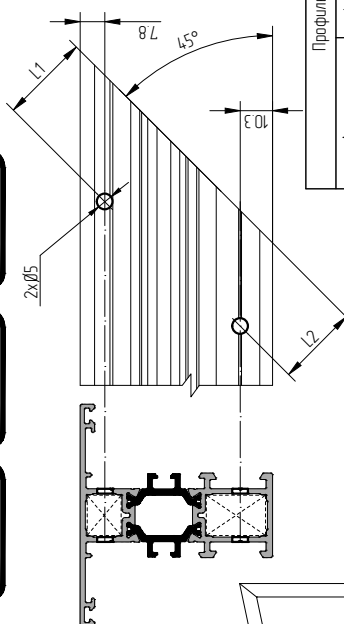




Профиль		L1, мм	L2, мм
Артикул			
АУРС W62 0101		28 2±0.1	25 8±0.1
АУРС W62 0121			
АУРС W62 0102		28 0±0.1	26 1±0.1
АУРС W62 0122			
АУРС W62 0103		28 2±0.1	26 1±0.1
АУРС W62 0123			
АУРС W62 0106			

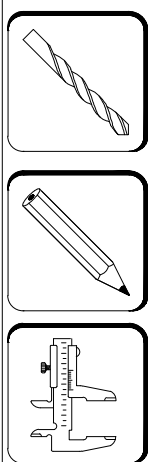

Профиль		L1, мм	L2, мм
Артикул			
АУРС W62 0301		28 2±0.1	25 8±0.1
АУРС W62 0302		28 0±0.1	26 1±0.1
АУРС W62 0303		28 2±0.1	26 1±0.1
АУРС W62 0314		28 2±0.1	26 1±0.1

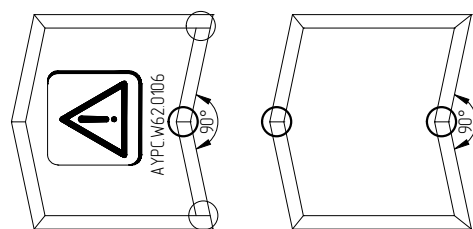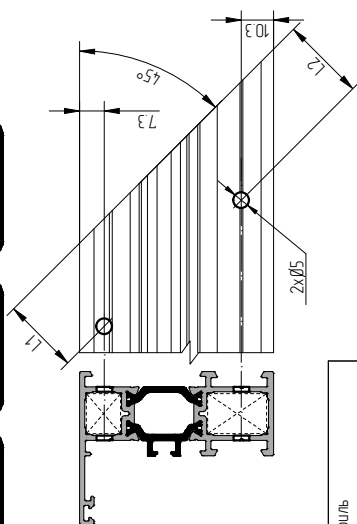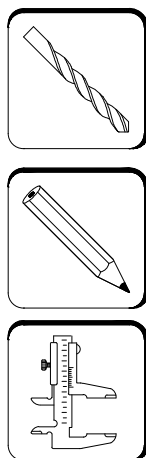

Профиль		L1, мм	L2, мм
Артикул			
АУРС W62 0101		28 6±0.1	27 8±0.1
АУРС W62 0121			
АУРС W62 0102		28 4±0.1	27 9±0.1
АУРС W62 0122			
АУРС W62 0103		28 3±0.1	27 8±0.1
АУРС W62 0123			
АУРС W62 0106			

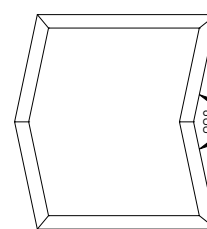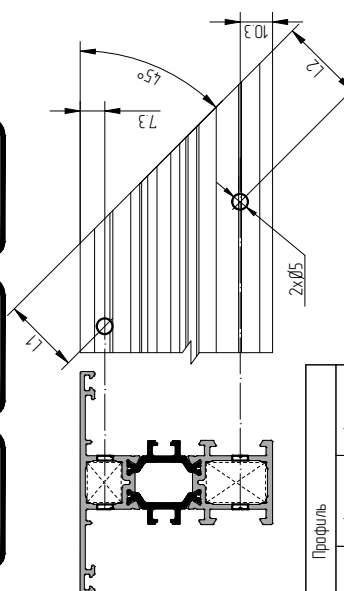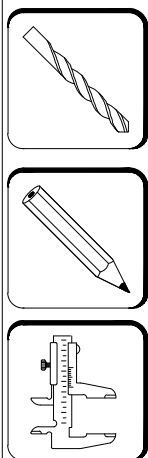

Профиль		L1, мм	L2, мм
Артикул			
АУРС W62 0301		28 6±0.1	27 8±0.1
АУРС W62 0302		28 4±0.1	27 9±0.1
АУРС W62 0303		28 3±0.1	27 8±0.1
АУРС W62 0314		28 3±0.1	27 8±0.1